



Final Inspection Report

WQS Insp. # [REDACTED]



Customer Information

Customer Reference Number: [REDACTED]_5_20_08
Name: [REDACTED]
Address: [REDACTED]
Contact Name: [REDACTED]
Contact Number: [REDACTED]

Factory Information

Name: [REDACTED]
Address: [REDACTED] Town, LongGang District, ShenZhen
Contact Name: [REDACTED]
Contact Email: [REDACTED]
Contact Number: +86 [REDACTED]
Inspection Date: June 28, 2008
Inspection Location: Factory Address (See Above)

Product Information

Product Name: Dining Chair
Product / Item Number: 0[REDACTED]-2#
Quantity Ordered: 1200
PI Number: [REDACTED]#
Styles / Colors: (Beech Wood in Maple Color) (Moro-fibre Fabric in Chocolate color No.09#)

Inspector Information

Inspector(s) Name: [REDACTED]
Inspector's Remarks: Overall the factory was nice, friendly and professional. The production appears to be well organized. However, it is highly unprofessional and fraudulent from the company to say that all goods were finished and ready for inspection when in fact there was over 30 being reworked due to a last minute internal inspection. (Please see the "Inspection Summary" below)
(Also see pictures of reworked chairs in the "Rework" section below)

Inspection Criteria

Routine Tests: No Specific Testing Required/Requested
Specific Tests Requested: No Specific Testing Required/Requested
Inspection Standards: [Sampling level = II, quantity inspected = 50, AQL Level 4 (Accept 5, Reject 6)]
Major Defects Found = 5
AQL Level
Minor Defects Found = 5
Critical = Not Applicable
Additional Remarks:



Final Inspection Report

WQS Insp. # [REDACTED]



Inspection Summary

Quantity Ready to Ship / Inspect: 367 units – 33 units were being reworked due to bad finishing (see REWORK section below)

Quantity Inspected: 50

Sampling Level: II

Specific Tests Requested: No Testing Requested

Overall: (Pass / Fail) – **PENDING** SINCE 33 UNITS NOT COMPLETED

Additional Remarks: The factory representative/contact informed our office that the production was 100% complete and ready for shipment by June 28. This is verifiable by email dated June 24 from Mr [REDACTED].

Defects List





MAJOR DEFECTS 1 - MAJOR Bad Patching / Filler (2" – high visibility)		
2 - MAJOR Bad Patching / Filler (4.5" – medium visibility)		
3 - MAJOR Mineral Streaking @ leg (6" – medium visibility)		



Final Inspection Report

WQS Insp. # [REDACTED]



4 - MAJOR Stain (.25") (high visibility)		
MINOR DEFECTS		
1 - MINOR Knots (.25") (Medium Visibilty)		
2 - MINOR Knot (.5") (Medium Visibilty)		
3 - MINOR Knot (1") (High Visibilty)		



Final Inspection Report

WQS Insp. # [REDACTED]



4 - MINOR Knot (.75") (High Visibilty)		
5 - MINOR Bad Filling and Finishing		

Additional Remarks: The number off chairs with small knots and discoloration (flecks) was abnormally high. Factory should choose better raw wood for processing.



Packing and Packaging

Unit Packing:

Cardboard Wrapped Over Chair Back -		
One plastic Bag Over the Chair Back -		
Two Corner Cushioned Covers -		
Four Padded Covers - One for eac leg of chair		



Final Inspection Report

WQS Insp. # [REDACTED]



Shipping Carton / Packing:

Shipping Mark on all Four Sides		
Width 24.75" (628.7mm)		
Height 39" (990.6mm)		
Depth 19.5" (495.3mm)		



Final Inspection Report

WQS Insp. # [REDACTED]



Reinforced		
First Chair and Separated		
Second Chair and Sealed		

Additional Remarks: We were unable to perform a drop test.

Product Details

Composition		
Slider (.5" tall) (.5" diameter)		

www.wqs-china-inspections.com

USA: 001 314 732 1738

reportsdept@wqs-china-inspections.com





Copyright ©2008 by WQS Ltd (HK)



Final Inspection Report

WQS Insp. # [REDACTED]



Seat Fabric		
	Front side	Back Side
Corner Blocks		
	Front Blocks – Level and Flush	Rear Blocks – Unlevel and Flush
		
	Cushion Bottom - 1	Cushion Bottom – 2
Foam = 1.5” (38mm) Plywood = . 5” (12.7mm)		
	Plywood and Poly-Foam	


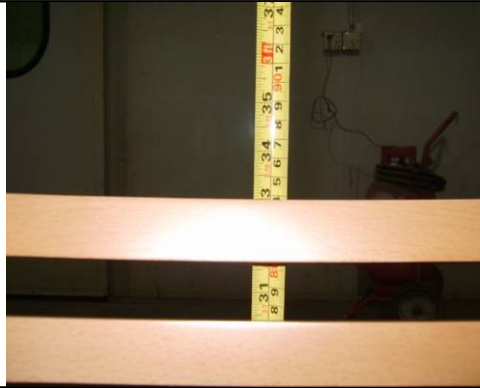




Final Inspection Report

WQS Insp. # [REDACTED]



Product Measurements

Overall Height 33" (838.2mm)		
Seat Height 19" (482.6mm)		
Seat Width 18.5" (469.9mm)		



Final Inspection Report

WQS Insp. # [REDACTED]



Seat Depth 18" (457.2mm)		
Backrest Width 16.25" (412.75mm)		

Remarks

PLEASE NOTE: More pictures are available via the internet online account.
Please enter you're the username and password we emailed to you.







Final Inspection Report

WQS Insp. # [REDACTED]



Reworks

24 units in the sanding room		
2 units in the spraying room		
4 units in the finished goods area		



Final Inspection Report

WQS Insp. # [REDACTED]



1 unit in the finished goods area		

Remarks

**One more chair was in a separate spray room (picture is not available)
MORE PICTURES ARE AVAILABLE ON YOUR ONLINE ACCOUNT. PLEASE CONTACT
YOUR ACCOUNT MANAGER FOR USERNAME AND PASSWORD.**

END OF REPORT