



Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009

Customer Information

Customer Name:
Address:
Contact Name:
Contact Number:

Factory Information

Name:
Address:
Contact Name:
Contact Email:
Contact Number:
Inspection Date:
Inspection Location: Guangdong China

Product Information

Product Name: Electric Food Slicer
Product / Item Number: 8809
Quantity Ordered: 4,452 pcs total
Styles / Colors: White

Inspector Information

Inspector(s) Name: Kenneth
Inspector's Remarks: Please pay close attention to the "blade length" and the "input voltage"...

Inspection Criteria

Routine Tests: No Specific Testing Required/Requested
Specific Tests Requested:
1 Test food slicer- ensure functioning properly including accessory
2 Check for leaks
3 Scan UPC – UPC = 0 [REDACTED] 5
5 Check Packaging
6 Check Plug type
7 Check Rating Label
8 Check Blade length:170mm
9 Check safety button
10 Check safety guard on manual
11 Test the input voltage 120v/60Hz and power 100w

Inspection Standards: Level II, AQL Minor Defects 2.5, Major Defects 1.0
Major Defects Found = 1
Minor Defects Found = 7
Critical = Not Applicable
Additional Remarks: Crack on housing after carton drop away 76cm



Final Inspection Report

WQS Insp. # [REDACTED] JUN25_09_FI009



Inspection Summary

Quantity Ready to Ship / Inspect: 4,452pcs /4,400pcs
Quantity Inspected: 200 pcs
Sampling Level: II
Specific Tests Requested: No Testing Requested
Overall: (Pass / Fail) - **PENDING (see additional remarks below)**

Additional Remarks:

1. Factory had still producing 52pcs slicer on production line during inspection; please refer to the attached photos below,
2. Actual measure blade length 165mm is deviated with required 170mm
3. Actual AC 120V/60Hz input voltage is deviated with required 230-240V/50Hz on inspection information form from client.

AQL Defects Summary & Sampling Plan

Inspection Standard	ANSI/ASQC Z1.4	AQL			Accepted	Total Found
Sampling plan	Single, Normal	Critical	:	Not Allowed	0	0
Inspection Level	Level II	Major	:	1.0	5	0
Sample Size	200 pcs	Minor	:	2.5	10	7

Test Item Results

Test item		S/S(pcs)	Result	comments:
1	Visual Workmanship	200 pcs	✓ Passed	
2	Appearance check	200pcs	✓ Passed	
3	Dimension checking	200pcs	<input type="checkbox"/> Passed <input type="checkbox"/> Failed	PENDING: Pls refer to the above remarks 2
Product full function test				
4	Hi-voltage test	200pcs	✓ Passed	
5	Polarity test	200pcs	✓ Passed	
6	Pull test	5pcs	✓ Passed	
7	Aging test	5pcs	✓ Passed	
8	Drop test	1ctn	<input type="checkbox"/> Passed <input type="checkbox"/> Failed	PENDING: One cracked housing
9	Balance test	5pcs	✓ Passed	
10	Labels/Marking check	200pcs	✓ Passed	
11	Packing	200pcs	✓ Passed	
12	Carton	50ctns	✓ Passed	
13	Inner box	200pcs	✓ Passed	
14	Artwork	200pcs	<input type="checkbox"/> Passed <input type="checkbox"/> Failed	PENDING: Pls refer to the photo below



1. VARIOUS MAJOR and MINOR

Comment

Major: 1 pcs (see drop test below)

Minor: 7 pcs



Drop Test Resulted in one cracked housing (see drop test below)

(Major: crack housing * 1pc)



Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009



Minor: oil residue on flatform * 1pc



Minor: Smudge on surface * 6pcs



Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009



Smudge



Smudge



Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009



Smudge



Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009



Shipping packing/Unit packing/label

Comment

4,452PCS =
1,113 carton *
4pcs/ carton




Packed cartons to read ship




Producing slicer



Sampled cartons to inspect

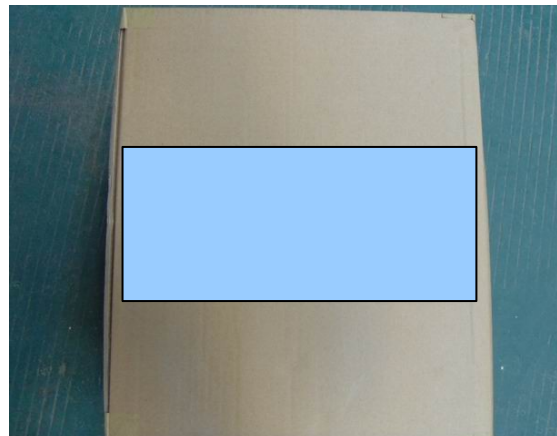

Main mark

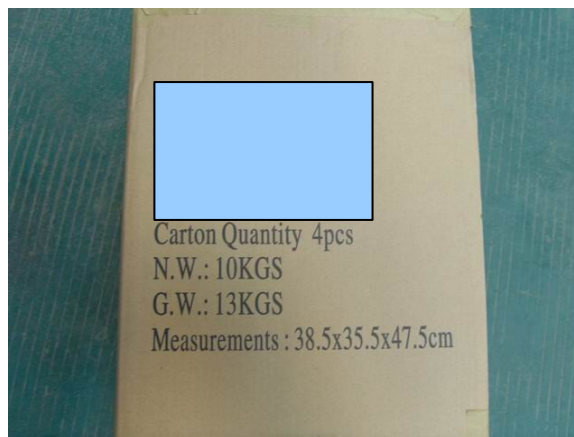

Side Mark



Carton opening




Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009




**Gift box
/Products**



Gift box

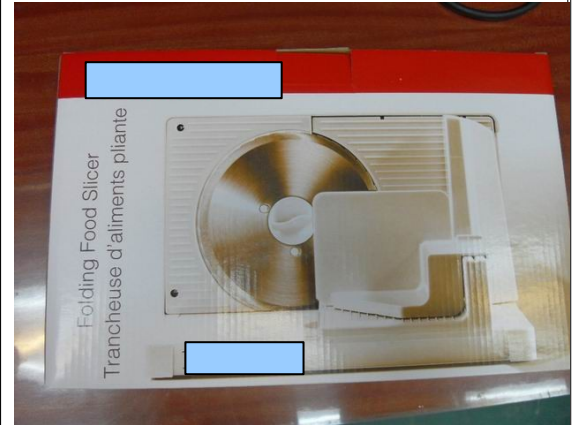

Front mark

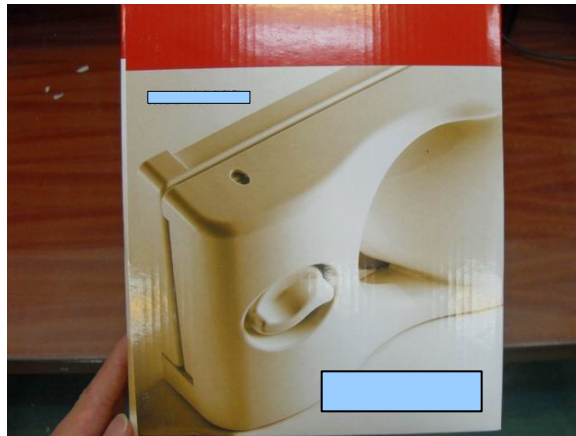


Side mark



Back mark 120V/60Hz (actual)
230-240V/50Hz (Requested)



Bottom mark

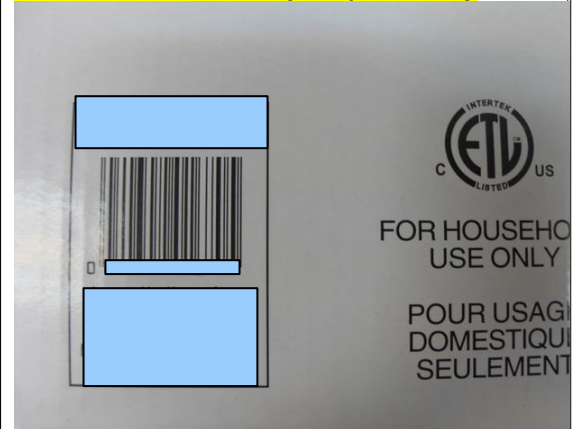

UPC and origin mark



Final Inspection Report


WQS Insp. # [REDACTED]_JUN25_09_FI009



Box opening




Polybag pack

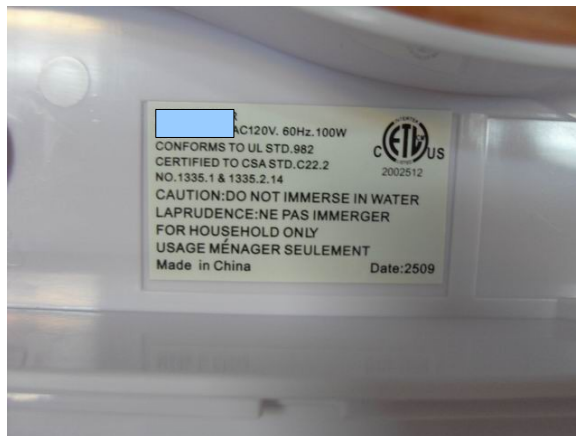

Rating label on bottom



Instruction

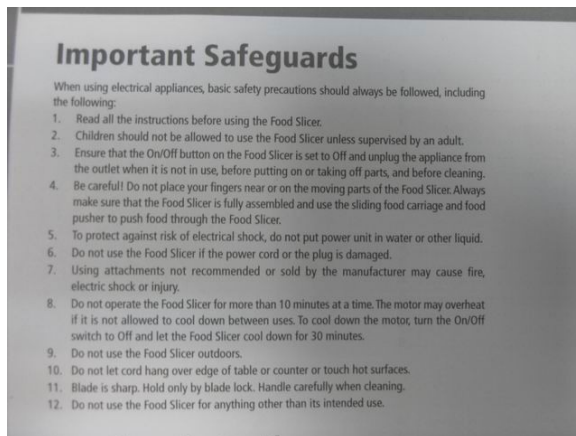

Safety instruction



Safety button



Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009



Power plug



Detachable blade



Logo on top



Product view



Product – measurement, power, Hi-pot test, UPC scan, plug and cord and drop test

Comment

Pls refer
the above
additional
remarks




Function Test



Function Test (with meat)



Power consumption test (100w)
AC120V/60Hz (actual)

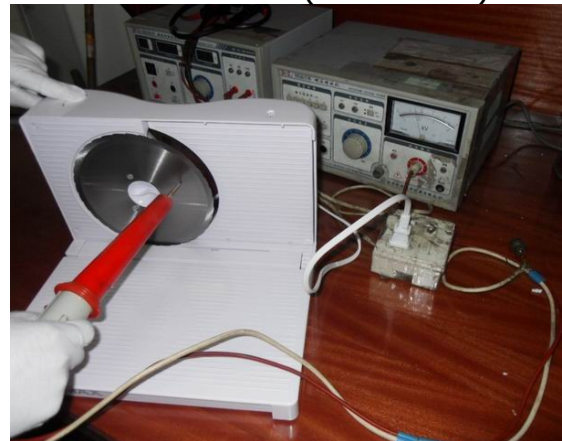

Hi pot test (1.5KV,0.5mA,1S)



Electrical Cord Pull Test



Drop Test A (away 76cm)




Final Inspection Report
WQS Insp. # [REDACTED]_JUN25_09_FI009




Drop Test B

(Major:crack housing * 1pc)

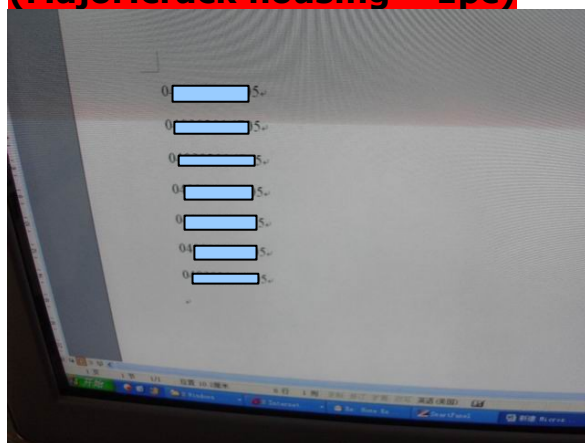

Scan UPC -
UPC = 040302016705

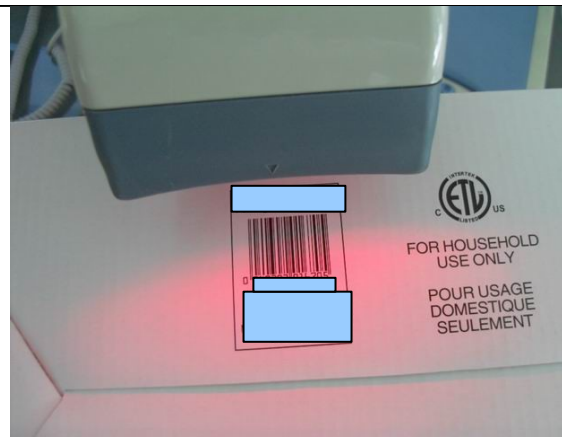

Scan UPC on bottom of gift box



Blade dimension:165mm (actual)
170mm (Requested)

END OF REPORT

www.wqs-china-inspections.com

USA: 001 314 732 1738

reportsdept@wqs-china-inspections.com

Copyright ©2008 by WQS Ltd (HK)